

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 1

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

R

Date: 11-05-13

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run

Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D407-667-245

Rev F

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D407-667-205

CHC006

8 11/06/07

110

0.00



Pick Kit
Packaging

Packaging

Memo

0.00

Packaging

DP

11-5-24

120

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend I

Memo

0.00

CNC Delta 100 Bender

1-Bend tube as per Dwg D407-667-245 using CNC bender program 407 Aft and Folio 21

DP

11-5-24

B69643

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Page 2

Friday, May 13, 2011 2:16:01 PM

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00



0.00 8/11/15/25

QC

Memo

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 3

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245

6-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Note: Aft side has 3x top holes.

7-Drill Fwd rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Drill only the top (3) holes.

8-C'sink holes as per Dwg D407-667-245. Allow rivet to sit below surface to compensate for paint.

9- Scribe tube to identify on the inner chamfer in the cuff D# and B#

10-Deburr & Inspect for surface damage. Repair damage within limits as per

JW
SAD
11-05-25

- JW 11-05-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 4

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	Dwg D407-667-245								
150 HandFXtube Hand Finishing Crosstubes	Crosstubes Chemical Conversion Memo	0.00 0.00				<u>SAD 11-05-26</u> <u>①</u>			
160 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00							
170 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM

Page 5

Item ID: D407-667-205

Accept

Revision ID:

Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00

Required Date: 5/23/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

180

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 0380
Issue P/O: 14176 LPI as per ASTM 1417
Level 2 Attach copy of NDT results to work order

CL 11/05/26 ①

190

Packaging

0.00



Packaging

Memo

0.00

Packaging

Ensure copy of NDT results attached to work order.

PC 11/05/26 ④

200

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

BT 11-05-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 6

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210 	SprayPaint	0.00							
SprayPaint	Memo	0.00							
Spray Painting	1-Prime inside and outside crosstube as per DEO D407-667-245 and QSI 005 4.2								
	2-Paint outside crosstube with White Imron as per QSI 005 4.2								
	PRIME:								
	Start Time: _____								
	Finish Time: _____								
	PAINT:								
	Start Time: _____								
	Finish Time: _____								
220 	QC14- Inspect Spray Paint	0.00							
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 7

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 Crosstubes	Crosstubes	0.00							
Crosstubes	Memo 1- Install chafing shield as per DEO D407-667-245. Note: (3) top holes should be facing up. 2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe 3- Install support with magnobond and install clamps as per Dwg D407-667-245 using installation jig DT9025. Torque clamps to 80-100 in lb A/R Magnobond Batch: <u>116677</u> EXP: <u>11-08</u> 4- Install nut plates as per Dwg D407-667-245. Touch-up rivet heads with Imron paint. <i>proceed m 117510</i>	0.00							
240 QC	QC5- Inspect part completeness to step on W/O	0.00							
Quality Control	Memo <i>Swishy</i>	0.00							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Friday, May 13, 2011 2:16:01 PM



Page 8

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 Packaging Packaging	Pick Kit Memo	0.00 0.00							
260 QC Quality Control	QC4- 100% Inspect kits for completeness Memo	0.00 0.00							
270 Packaging Packaging	Packaging Memo Identify and in kanban rack Location: _____	0.00 0.00							

11/5/31

8 11/6/11

11/6/11

NCR

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69643

Page 9

Friday, May 13, 2011 2:16:01 PM

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 5/13/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start



QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/6/30
MF
11-06-01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, May 13, 2011 2:16:08 PM

Page 1

Work Order ID: 69643

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft



Start Date: 5/13/2011

Required Date: 5/23/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:C 05.09.02 Add holes for compatibility with Bell Skidtubes KJ/JLM
IPP Rev:D Added Magnobond, Rubber Cushion & Clamps 07-02-19
JLM

****CHANGE TO CHG 005 - IF USING D2894-1 B35578 OR GREATER****
IPP Rev:E 08-05-22 add comment in seq. 6 and QC15 and QC5 DD verified by:EC
IPP Rev:F 08-06-12 add comment in seq. 24 DD verified by:EC
IPP Rev:G 08-08-19 revE as per dwg DD verified by:EC
IPP Rev H 09.01.06 ECN 08-562 EC verified by:DD IPP Rev:I
10.04.07 revise route seq. in bom DD verified by:JLM IPP Rev J
11.04.26 removed abrasion strip ecn 11-551 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D407-667-205TRN 		Manufactured	No	B67818		110	Each	0.0000	1	1		11-5-24	
Crosstube Turning Detail													
AN960JD516 	NAS1149D0563J	Purchased	No			230	Each	0.0000	18	18		M117291 06/3/89	
Washer D2873-043 		Manufactured	No			230	Each	40.0000	2	2		25 11-05-31	
Nut Plate Assembly													

Location

Loc Qty

Loc Code

LG 36
68084 16
68801 20
LG052 4
66898 4

x2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, May 13, 2011 2:16:08 PM

Work Order ID: 69643

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 5/13/2011

Required Date: 5/23/2011

Start Qty: 1.00

Required Qty: 1.00

D2873-045

Manufactured No

230

Each

35.0000

2

2



Nut Plate Assembly



25 11-05-31

Location

Loc Qty

Loc Code

LG

20

68800

20

LG052

15

65992

5

67741

10

x2

D2894-1

Manufactured No

230

Each

10.0000

1

1



2.750 Support



25 11-05-30

Location

Loc Qty

Loc Code

LG

6

66702

6

LG052

4

43881

4

x1

D3190-1

Manufactured No

230

Each

18.0000

2

2



Chafing Shield



25 11-05-30

Location

Loc Qty

Loc Code

LG

14

68372

14

LG055

4

58569

4

x2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, May 13, 2011 2:16:09 PM

Work Order ID: 69643

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 5/13/2011

Required Date: 5/23/2011

Start Qty: 1.00

Required Qty: 1.00

D3595-063-450

Manufactured

No

230

Each

65.5400

2

2



RUBBER CUSHION



85 11-05-30

Location

Loc Qty

Loc Code

LG

52

67353

7

68893

45

LG055

13.54

68157

13.54

x 2

MS20601-AD4W8

Purchased

No

230

Each

237.0000

14

14



RIVET



85 11-05-30

Location

Loc Qty

Loc Code

LG

100

108521

100

LG051

137

117106

37

117381

100

x 14

MS21920-22

Purchased

No

230

Each

95.0000

4

4



Clamp(per MIL-DTL-8783C)



85 11-05-30

Location

Loc Qty

Loc Code

LG050

95

116207

7

117279

38

117506

50

x 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, May 13, 2011 2:16:09 PM

Work Order ID: 69643

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 5/13/2011

Required Date: 5/23/2011

Start Qty: 1.00

Required Qty: 1.00

MS21920-25 - 24



Clamp(per MIL-DTL-8783C)

Purchased

No

230

Each

2.0000

2

2

M 108258



25 11-05-30

(P+0) -7

Location

Loc Qty

Loc Code

LG050

2

116264

2

Purchased

No

250

Each

180.0000

10

10

AN5-10A



Bolt

Location

Loc Qty

Loc Code

ST337

180

117313

180

Purchased

No

250

Each

176.0000

4

4

AN5-32A



Bolt

Location

Loc Qty

Loc Code

ST340

176

115589

51

117161

50

117514

50

117688

25

Purchased

No

250

Each

60.0000

4

4

AN5-34A



Bolt

Location

Loc Qty

Loc Code

ST340

60

116704

20

117010

20

117366

20

W/O: 69643		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
110530		use MS 21920-24 clamps - 25 now are stock - 26 too long	RT	11 05-30		11.05.30 OSI 042	11/05/31

Part No: D407-667-205 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 5

Friday, May 13, 2011 2:16:09 PM

Work Order ID: 69643

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft



Start Date: 5/13/2011

Required Date: 5/23/2011

Start Qty: 1.00

Required Qty: 1.00

MS21042L5

Purchased

No

250

Each

1,275.000

4

4



Nut



ShukB

Location

Loc Qty

Loc Code

ST300

1275

116105

315

116548

260

117441

500

117591

100

117611

100

4

Friday, May 13, 2011 2:16:09 PM

Shop Packet Print

Page 5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	<i>09443</i>
Description: Crosstube High Aft (407)	Part Number:	D407-667-205
Inspection Dwg: D407-667-245	Rev: F	Page 1 of 1

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	45.86	45.98
Angle	54	56
Total Span	91.72	91.96

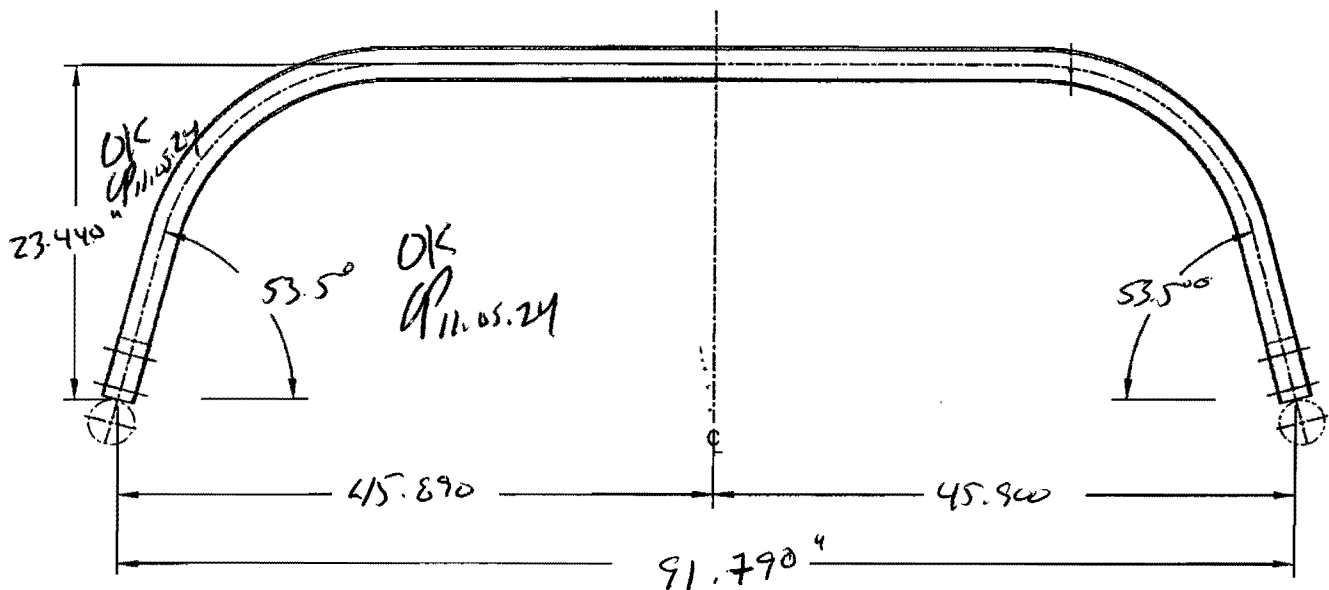

Comments
Height and angles under tolerance Acceptable P 11.05.24 PSI OK

QC15 Inspection	<i>S</i>
Date	11/05/25

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.06.22	Dwg Rev updated	KJ	<i>[Signature]</i>

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 69643

11-05-13

DEO ATTACHED

RELEASED
08/11/12

F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECR#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -B51 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN	RF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.11.06		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D407-667-245	REV. F SHEET 1 OF 4
TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	SCALE NTS
COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	






W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr.	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

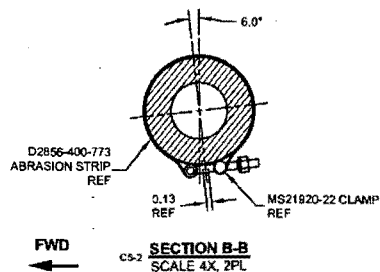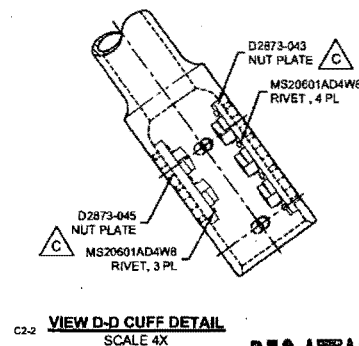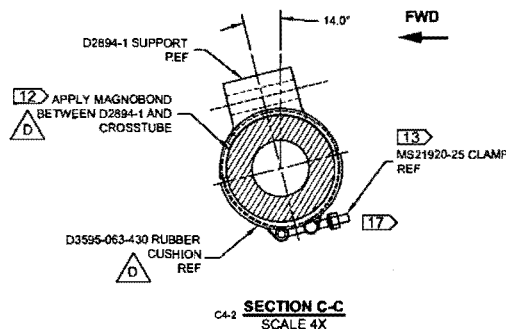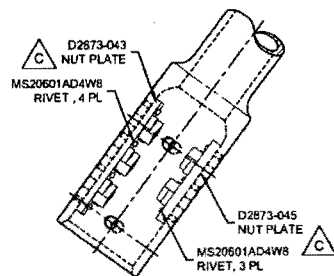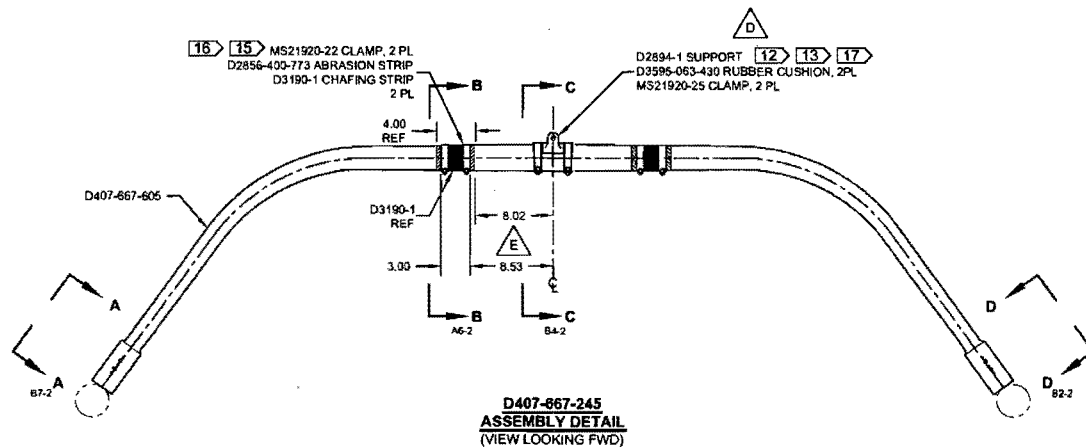

**DEO ATTACHED
RELEASED**

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 2 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W060443

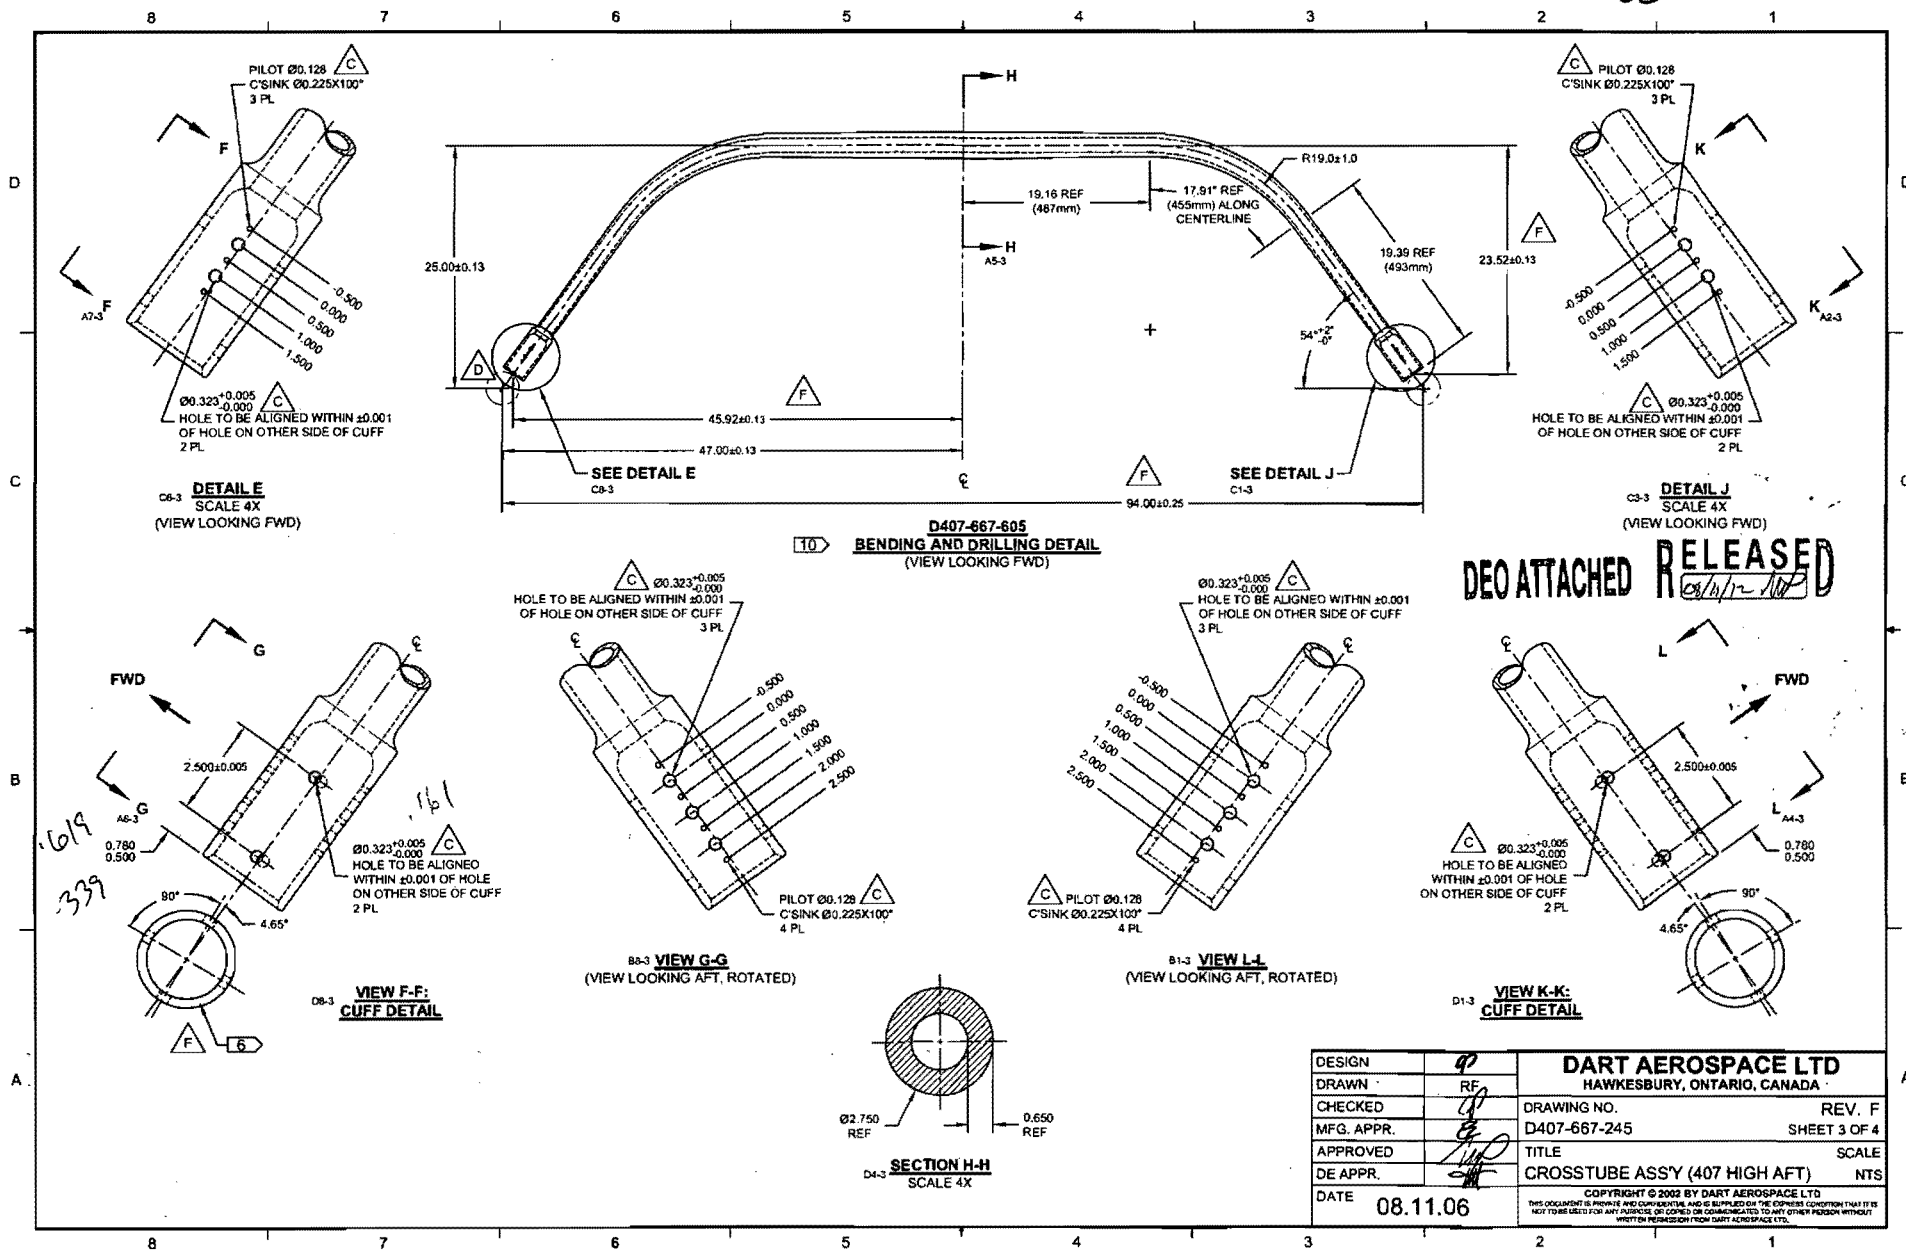

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


SEE DETAIL M
A7-4

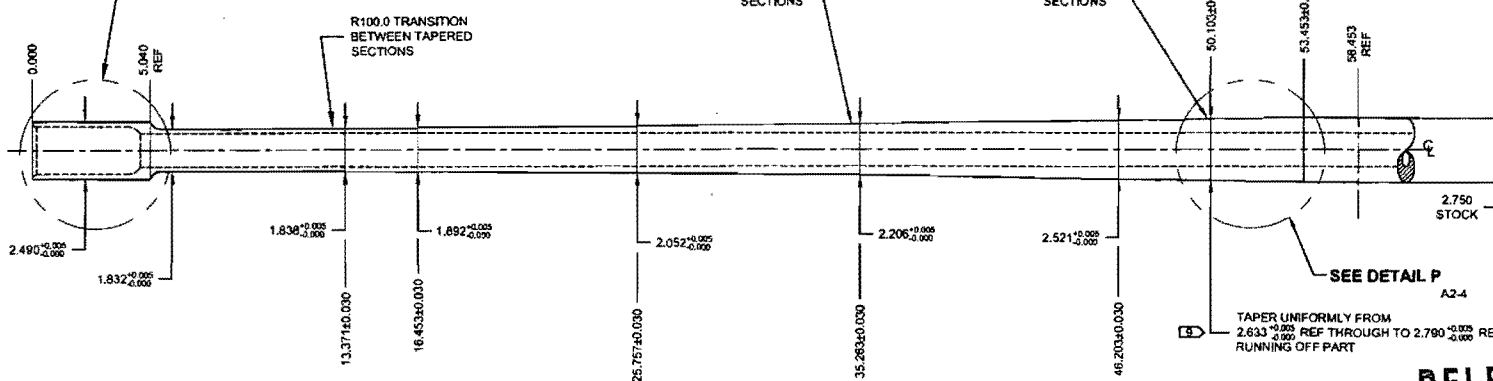


D407-667-245 MACHINING DETAIL

RELEASED
08/11/12


u/o call 43

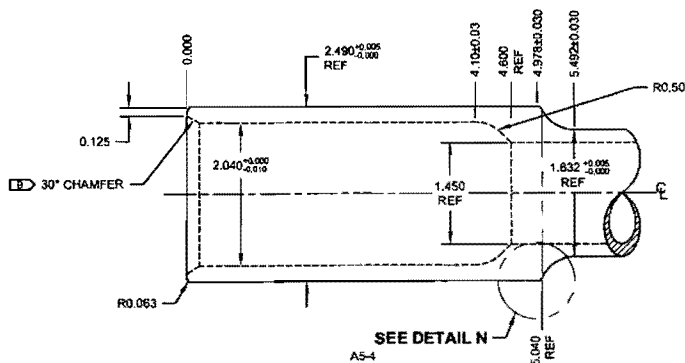

DETAIL M: CROSSTUBE CUFF
SCALE 3X

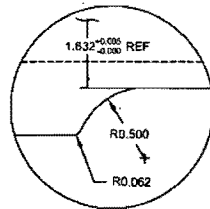

DETAIL N: CUFF TRANSITION
SCALE 2X

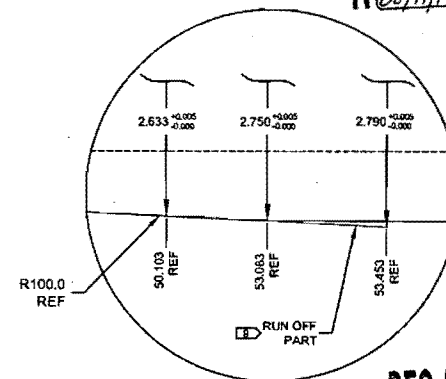

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

DEO ATTACHED

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 4 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED		DE APPR.		
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3180-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3180-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-18

W069643

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F.1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>RE</i>	APPROVED <i>WP</i>	DE APPR. <i>44</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASE
2011-04-10
W/D

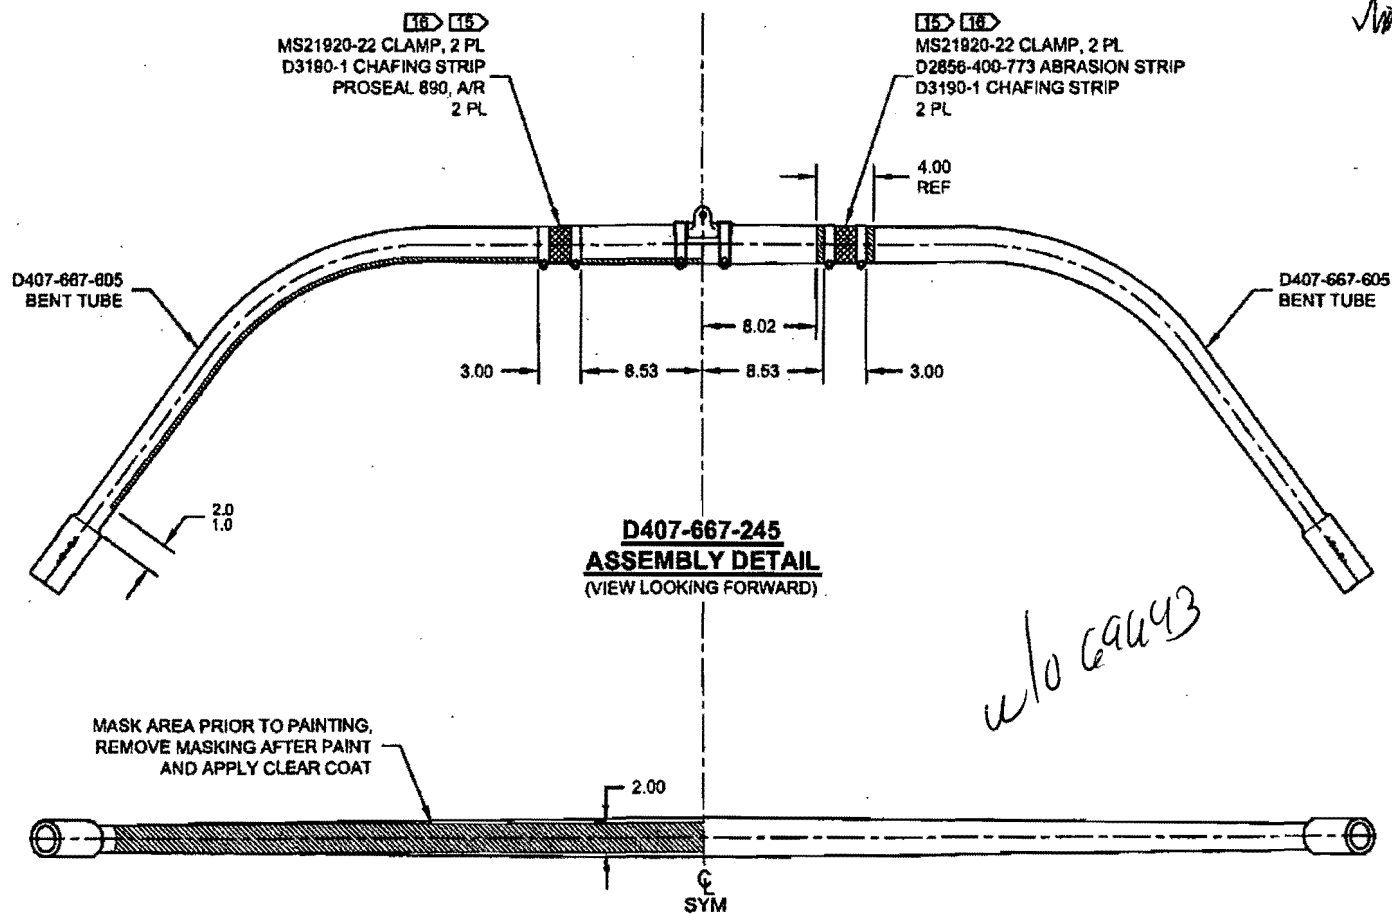

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P- 05611

CLIENT DART AEROSPACE DATE MAY-26-2011 PAGE 1 OF 1
ATTENTION Lynda Leland / CHAIRMAN ACUREN JOB NO. 188-11-00133 TIME AM ☒ PM ☐
ADDRESS 1270, ABERDEEN RD PO/WO NO. 14176
HAWKESBURY, ON WORK LOCATION AS ADDRESS
ACCEPTANCE STD. ASTM E1417/ASTM E133 REV./DATE 2005
PROJECT WET FLUORESCENT LIQUID PENETRANT INSPECTION ON 4 CROSSTUBES
TEM(S) EXAMINED - SEE BELOW

JOB DESCRIPTION PROCEDURE NO. LT008 REV./DATE 2008 TECHNIQUE NO. LT-008 REV./DATE 2008
PART NO. MATERIAL ALUMINUM THICKNESS N/A
SCOPE PERFORMED A WET-FLUO L.P. INSPECTION ON 100% OF THE EXTERNAL SURFACE ON CROSSTUBES.

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 13798 ☐ OUTPUT > 1000 μ W/CM² ☒ AMBIENT < 2 fc
PENETRANT ZL-67 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H₂O MINIMUM DRY TIME >10 MIN. OTHER
DEVELOPER SKD-50 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE AUG 10/2011
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < - 4°C/ 20°F ☐ - 4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ☐ METRIC ☐ IMPERIAL

1 CROSS-TUBE W.O. ID 69643 ✓
2 W.O. ID 69644 ✓
3 W.O. ID 69584 ✓
4 W.O. ID 69585 ✓
ITEM ID D407-667-205 AFT
D407-667-205 AFT
D212-664-201 AFT
D212-664-201 AFT
NO RELEVANT INDICATION WAS DETECTED
AS PER APPLICABLE STANDARD
RT 11-05-26

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.
Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES
CLIENT REPRESENTATIVE Jan Titley DTR# E44662
TECHNICIAN (SIGNATURE): [Signature] REPORT REVIEWED BY:
NAME (PRINT): 1st TECHNICIAN NAME INITIALS
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL 2 SNT LEVEL 2
CGSB REG. No. 3049 CGSB REG. No. 3049

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

